Display Pressure Transmitters

PTF30 Series

INSTRUCTION MANUAL

TCD210242AE

Autonics

Thank you for choosing our Autonics product.
Read and understand the instruction manual and manual thoroughly before using the product.
For your safety, read and follow the below safety considerations before using.
For your safety, read and follow the considerations written in the instruction manual, other manuals and Autonics website.
Keep this instruction manual in a place where you can find easily.

Visit Autonics website (www.autonics.com or QR code) for the latest information. Manuals, CAD files, certifications, software, etc. are available. The dimensions, specifications, certifications, etc. are subject to change without notice for product improvement. Certain models may be discontinued without notice.

Safety Considerations

- Observe all 'Safety Considerations' for safe and proper operation to avoid hazards.
- ⚠ symbol indicates caution due to special circumstances in which hazards may occur.

⚠ Warning Failure to follow instructions may result in serious injury or death.

01. Fail-safe device must be installed when using the unit with machinery that may cause serious injury or substantial economic loss.(e.g. nuclear power control, medical equipment, ships, vehicles, railways, aircraft, combustion apparatus, safety equipment, crime/disaster prevention devices, etc.)
Failure to follow this instruction may result in personal injury, economic loss or fire.
02. Do not use or store the unit in the place where flammable/explosive/ corrosive gas, high humidity, direct sunlight, radiant heat, vibration, impact or salinity may be present.
Failure to follow this instruction may result in explosion or fire.
03. The explosion proof standard of this unit is Ex d IIC T6, protection structure of this unit is IP67 and the range of max. surface temperature is below 85°C.
04. Do not disassemble or modify the unit.
Failure to follow this instruction may result in fire or electric shock.

⚠ Caution Failure to follow instructions may result in injury or product damage.

01. Do not apply beyond rated pressure.
Failure to follow this instruction may result in product damage.
02. Use the unit within the rated specifications.
Failure to follow this instruction may result in fire or product damage.
03. Keep the product away from metal chip, dust, and wire residue which flow into the unit.
Failure to follow this instruction may result in fire or product damage.
04. Check 'Connections' before wiring.
Failure to follow this instruction may result in explosion or fire.
05. This product is designed to detect the pressure of noncorrosive medium. Do not use for corrosive medium.
Failure to follow this instruction may result in product damage.
06. Use a dry cloth to clean the unit, and do not use water or organic solvent.
Failure to follow this instruction may result in fire or electric shock.

Cautions during Use

- Follow instructions in 'Cautions during Use'. Otherwise, it may cause unexpected accidents.
- Power supply should be insulated and limited voltage / current or Class 2, SELV power supply device.
- The connection of this unit should be separated from the power line and high voltage line in order to prevent inductive noise.
- Do not use this unit near the high frequency instruments.
- Switch or circuit breaker should be installed nearby users for convenient control.
- Use verified explosion-proof cable gland or sealing fitting (explosion proof standard: over Ex d IIC T6, IP rating: over IP67 protection structure).
- Use dedicated external terminal for earth. For connecting earth, use a spring washer and earth cable which is over 4 mm^2.
- LCD performance may vary depending on the usage environment. Check the environmental conditions, and do not install the device in places where direct sunlight or high temperatures may be present.

- This unit may be used in the following environments.
  - Indoor / Outdoor (in the environment condition rated in 'Specifications')
  - Altitude max. 2,000 m
  - Pollution degree 2
  - Installation category II
- **This explosion-proof unit is certified and the same specifications which is reported to Korea Gas Safety Corporation. (This unit is manufactured following by the announcement 2013-54 of Ministry of Employment and Labor of Korea.)**

Ordering Information

This is only for reference, the actual product does not support all combinations.
For selecting the specified model, follow the Autonics website .

PTF30 - ❶ ❷ N ❸ ❹ - (❺)

❶ Pressure type
G: Gauge, sealed gauge [01]
A: Absolute

❷ Rated pressure range

Gauge		Absolute
1	0 to 35 kPa	0 to 35 kPa
2	0 to 0.1 MPa	0 to 0.1 MPa
3	0 to 0.2 MPa	0 to 0.2 MPa
4	0 to 0.7 MPa	0 to 0.7 MPa
5	0 to 2 MPa	0 to 2 MPa
6	0 to 3.5 MPa	0 to 3.5 MPa
7	0 to 7 MPa	
8	0 to 21 MPa	
9	0 to 35 MPa	
Sealed gauge		
A	-35 to 0 kPa	-
C	-0.1 to 0 MPa	
F	-0.1 to 0.2 MPa	
H	-0.1 to 0.7 MPa	
M	-0.1 to 2 MPa	
O	-0.1 to 3.5 MPa	
Z	User pressure range	

❸ Install bracket
N: Without bracket
B: With bracket

❹ Pressure port
F8: G3/8 (PF)

❺ User pressure range [02]
Customized pressure range and unit

01) The unit is sealed structure. Measurements are taken based on the standard atmospheric pressure at the time of sealing.
Standard atmospheric pressure = 101.3 kPa (1.013 bar)
02) The pressure range is set to customized pressure range. (select "Z" at ② Rated pressure range)

Product Components

- Product
- Instruction manual

Specifications

Series	**PTF30**
Applicable medium	Gas, liquid, oil (except corrosive environment of SUS316)
Power supply	15 - 35 VDC⎓
Output	DC 4 - 20 mA (2-wire, impedance: ≤ 30 Ω, low limit: 3.6 mA (- 2.5 %), high limit: 21.6 mA (+ 10 %)
Accuracy [01]	± 0.2 % of F.S. (at 25 °C)
Temperature characteristic	± (0.075 % × URL + 0.15 % × Span) (at 20 °C)
Sampling period	300 ms
Setting method	Front key
Display type	12 segment LCD, 4 digit
Certification	CE UK EAC
Unit weight	≈ 1.2 kg


01) F.S. is rated pressure range.

Insulation Resistance	≥ 100 MΩ (500 VDC⎓ megger)
Max. pressure	300 % of max. rated pressure
Dielectric strength	Between the charging part and the case: 1,000 VAC~ for 1 min
Vibration	0.75 mm amplitude at frequency of 5 to 55 Hz in each X, Y, Z direction for 2 hours
Noise immunity	Square shaped noise by noise simulator (pulse width 1 μs) ± 240 V
Memory retention	≈ 10 years (non-volatile semiconductor memory type)
Ambient temperature	-20 to 70 °C, storage: -20 to 80 °C (rated at no freezing or condensation)
Ambient humidity	0 to 85 %RH (rated at no freezing or condensation)
Protection structure	IP67 (IEC standard)
Material	Body: aluminum (AlDc.8S), cover O - Ring: Buna N, diaphragm: SUS316, connection: SUS316
Explosion class [01]	Ex d IIC T6


01) This explosion class is acquired and managed by Konics Co., Ltd.

Dimensions


- Unit: mm, For the detailed drawings, follow the Autonics website.

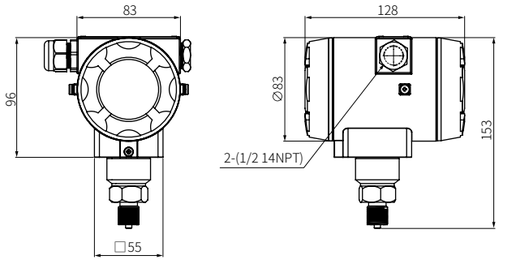


■ **With bracket**

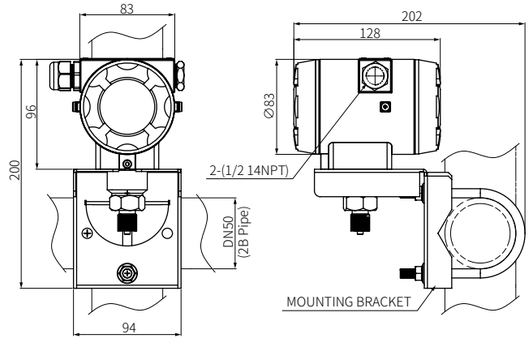

Connections

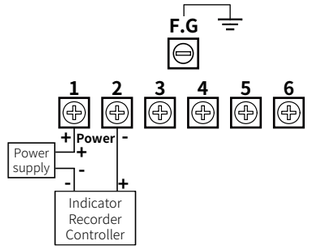

Unit Descriptions

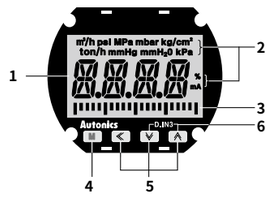

1. **Display part**
   Displays PV (present value), SV (Setting value) and error discription.
2. **Unit display part**
   Displays the currently set input unit.
3. **Output scale bar graph**
   Displays output DC 4 - 20 mA as scale bar graph by 5% unit.
4. **[M] key**
   Used to enter parameter mode, move parameters and save SV.
5. **[◀], [▼], [▲] key**
   Used to enter parameter set mode, move digits.
6. **D.IN3**
   Press [▼] + [▲] keys at the same time for 3 sec to executes digital input function. (parameter)

Mode Setting

RUN → [▲] + [▼] for 3 sec → **Digital input** → Auto → **RUN**
RUN → [M] → **Parameter setting** → [M] for 3 sec → **RUN**
RUN → Power ON with [M] + [◀] → **Parameter reset** → Refer to 'Parameter Reset' → **RUN**

Parameter Setting

- Some parameters are activated/deactivated depending on the model or setting of other parameters.
- After entering setting group, press the [M] key for 3 sec or there is no additional key input in 30 sec, it returns to RUN mode.
- [M] key: saves setting value and moves to the next parameter.
  [◀] key: moves digit
  [▼], [▲] key: changes setting value,

Parameter		Display	Default	Setting range	Condition
1-1	Pressure unit	UNIt	bAR	bar, mbar, Pa, kPa, MPa, G.CM (gf/cm²), KG.CM (kgf/cm²), M.M.H2 (mmH₂O), psi, mmHg, %, OFF	-
1-2	Input value low limit	L-RG	0.000	Within rated pressure range	-
1-3	Input value high limit	H-RG	0.350		
1-4	Decimal point	dP	0.000	0.0, 0.00, 0.000, 0 • Setting range differs depending on the rated pressure range	-
1-5	Display scale low limit	L-SC	0000	-1999 to 9999	1-1 Pressure unit: %, OFF
1-6	Display scale high limit	H-SC	1000		
1-7	Zero-point adjustment	ZERo	000	-999 to 999	-
1-8	Slope correction	SPAN	1000	0.900 to 1.100	-
1-9	Output scale low limit	LoUt	0.000	Within rated pressure range or within 1-5 / 6 display scale low / high limit*	* 1-1 Pressure unit: %, OFF
1-10	Output scale high limit	HoUt	0.350		
1-11	Moving average digital filter	MAV.F	04	01 (OFF) to 16	-
1-12	Digital input key	di-K	Hold	HOLD: hold display value, Z-TM: remote zero [01]	-
1-13	RUN mode display value 1	dSP1	PV	PV: present value, OUT: output, L.PEK: min. value [02] H.PEK: max. value [02]	-
1-14	RUN mode display value 2	dSP2	PV		
1-15	Dual unit	tUF	oFF	[Sealed gauge model] OFF, ON	-
1-16	Lock	LoCK	oFF	OFF: enable to check / set, LOC.1: enable to check / disable to set, LOC.2: disable to check / set	-

01) It is possible to check and change correction value in 1-7 zero-point adjustment.
02) When selecting L.PEK / H.PEK, left / right side of output scale bar graph flashes for 0.5sec.
When the min. / max. value is out of the temperature range, it displays LLLL / HHHH and it can be initialized to PV by pressing [▲] + [▼] keys for 3 sec.

Parameter Reset

Resets all parameters as factory default.
1. While holding down the [M] + [◀] keys, turn ON the power of the device.
2. When 'CLR' appears in display part, press [M] key to parameter reset mode.
3. When 'NO' appears in display part, change the text to 'YES' by pressing [▲], [▼] key in display part and press [M] key to finish the reset process.

Errors

Display	Operation	Troubleshooting
HHHH	Flashes when measured pressure is higher than the input value high limit.	Adjust measured pressure within the input value high / low limit.
LLLL	Flashes when measured pressure is higher than the input value low limit.	
ERR	Flashes when there in an error to SV.	Check the setting values and reset.

18, Bansong-ro 513Beon-gil, Haeundae-gu, Busan, Republic of Korea, 48002
www.autonics.com | +82-2-2048-1577 | sales@autonics.com

Autonics